

SUMMARY 1924 Peach Tree Lane , Bethlehem, Pa 18015 Creighton Faust October 17, 2024




3.3.1 Roof Drainage Systems

### **DEBRIS**



Debris has accumulated in the gutters. The gutters should be maintained to correctly facilitate water flow.

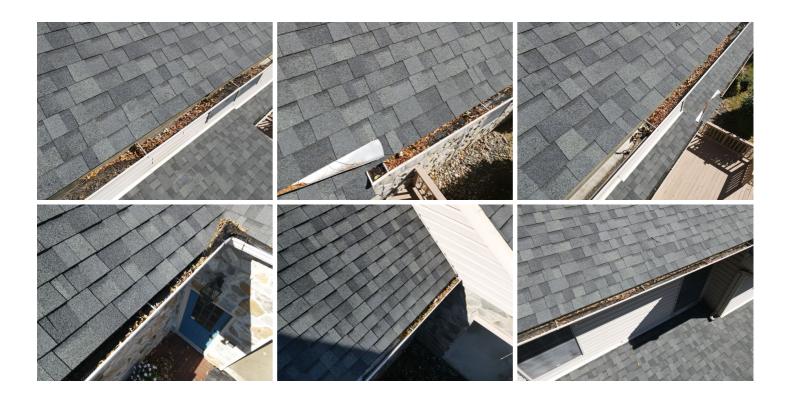

# 3.5.1 Chimney CHIMNEY CROWN CRACKED OR DETERIORATED



The masonry cap or crown is cracked or deteriorated. This can allow water to penetrate and damage the structure. The cap should be repaired or replaced as needed.

Recommendation Contact a qualified professional.




4.2.1 Walkways, Stoops, Steps, Patios & Driveways WALKS UNEVEN



CDA Inspection Services Page 1 of 15

The walks are uneven at a few small areas. This is a safety concern-trip hazard, suggest making repairs to create an even and level surface.

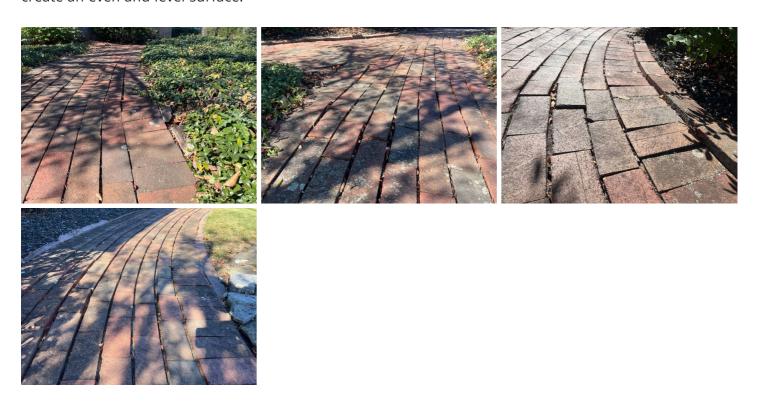

4.2.2 Walkways, Stoops, Steps, Patios & Driveways **DRIVEWAY CRACKING** 



Cracking was observed. Recommend monitoring and/or have contractor patch/seal.



4.4.1 Siding MILDEW/ALGAE



CDA Inspection Services Page 2 of 15

There are signs of a green bio-growth and/or mildew on the siding. This is a cosmetic issue and is not uncommon especially on shaded portions of the home. Recommend that said areas be washed or cleaned or a regular basis.



4.4.2 Siding

# POINTING/LOOSE MORTAR JOINTS



The masonry mortar joints are deteriorated, loose or missing. Mortar holds the masonry units together and prevents moisture entry. These areas should be further evaluated and repaired by a qualified contractor or mason.

Recommendation Contact a qualified professional.







4.4.3 Siding **STAINING** 



There was staining on the siding present during the inspection.

Recommendation

Contact a qualified professional.



4.4.4 Siding

# **CRACKING**

**BACK ADDITION** 



There is horizontal cracking at the mortar joints in the masonry wall. This may be due to the early settlement of the addition. You should have this further evaluated by a qualified professional and follow their recommendations.

Recommendation

Contact a qualified professional.

CDA Inspection Services Page 3 of 15







# 4.4.5 Siding SIGNS OF PREVIOUS REPAIR



There was signs of previous repair to the exterior of the building. You may want to ask the current owner for more information regarding this.

Recommendation Contact a qualified professional.



### 4.5.1 Trim

# **DETERIORATED PAINT**



The paint is deteriorated at various areas of trim. The trim should be re-painted to protect the wood from the exterior extremities.

Recommendation Contact a qualified professional.







CDA Inspection Services Page 4 of 15

4.6.1 Exterior Doors

### DOUBLE CYLINDER DEADBOLT



**GARAGE** 

The Exterior door(s) have a double cylinder deadbolt that require a key to open from either side. This may hamper emergency egress. You should have these changed to an interior thumb latch.

Recommendation Contact a qualified professional.



4.6.2 Exterior Doors

#### DOOR STICKS/RUB

One or more doors sticks and or rubs.

Recommendation Contact a qualified professional.





Maintenance / Service

4.8.1 Decks, Balconies, Porches & Steps

#### WOOD IN CONTACT WITH GROUND



Recommendation Contact a qualified professional.





4.8.2 Decks, Balconies, Porches & Steps

# **DECK/PORCH - ROTTED BOARDS**



One or more deck or porch boards are showing signs of rot. You should have a qualified contractor or deck builder further evaluate repair or replace the deck or porch floor boards.

CDA Inspection Services Page 5 of 15











# 4.8.3 Decks, Balconies, Porches & Steps ROT AT WOOD SUPPORT COLUMN BASE



FRONT PORCH

There is rot a one or more wood column base areas. Behind the rot you can see a clear and post, showing the rot is present on the capping/trim, not the post itself. The calling/trim should be replaced.

Recommendation Contact a qualified professional.





5.2.1 Foundation FOUNDATION CRACKS



CDA Inspection Services Page 6 of 15

There are typical crack(s) present at some areas of the foundation wall. This is common as concrete ages and shrinks where surface cracks are normal at approximately 1/16". You should monitor for any additional change or moisture at these areas. If leakage should occur these can be sealed by a qualified contractor.



#### 5.2.2 Foundation

### FOUNDATION CRACKS-STAINS/EFFLORESCENCE



Foundation cracks were observed with signs of moisture evidence. While the size of the cracks are that of typical concrete settlement, efflorescence and/or staining was present at areas. This is typically a sign of moisture penetration. You should seal the cracks and monitor the areas.

Recommendation Contact a qualified professional.









# 5.3.1 Floor Structure **ROT AT BAND JOIST**

Major Items


FRONT BASEMENT, RIGHT OF FRONT DOOR

Rot was observed at the band joist. This area should be repaired by a qualified professional. The source of moisture must be addressed to prevent reoccurrence.

Recommendation

Contact a qualified professional.

CDA Inspection Services Page 7 of 15

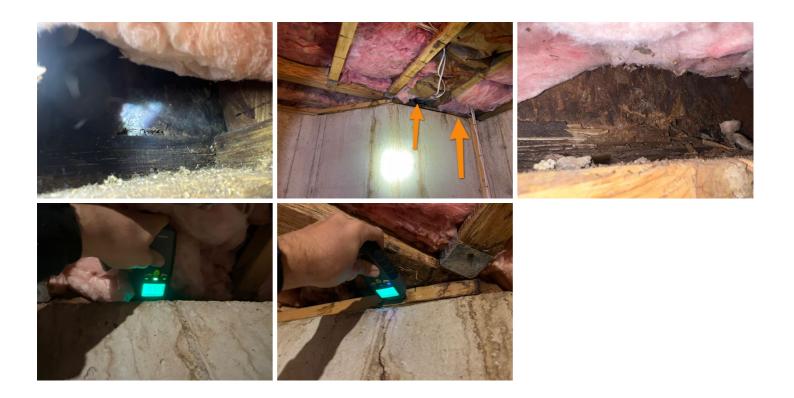

# 5.6.1 Roof Structure STAINS TESTED AND DRY



ATTIC AT VENT FLASHING

There were stains that were tested and appeared to be dry at the time of this inspection. This appears to be from a previous water leak that was not active. You should monitor the area(s).

Recommendation Contact a qualified professional.





# 6.7.1 Moisture **STAINS**



There is past or present stains. This is an indication of previous moisture entry. You should monitor the areas.

Recommendation

Contact a qualified professional.

CDA Inspection Services Page 8 of 15









7.4.1 Main & Subpanels & Main Overcurrent



### **UNUSED OPENINGS**

ELECTRICAL PANEL

There are unused openings in the panel. This is a safety concern. The openings should be covered to prevent possible shock.

Recommendation Contact a qualified professional.



7.6.1 Lighting Fixtures, Switches & Receptacles

### Safety Defects COVER PLATES DAMAGED/LOOSE/MISSING

ATTIC ABOVE GARAGE

One or more receptacles have a damaged, loose or missing cover plate. This is a safety concern. The covers should be replaced.



7.6.2 Lighting Fixtures, Switches & Receptacles



# DAMAGED RECEPTACLE

PANEL GFCI

Receptacle was damaged at the time of the inspection. Replacement is recommended.

**CDA Inspection Services** Page 9 of 15



#### 7.7.1 GFCI/AFCI

# GFCI OUTLET(S) MISSING

LAUNDRY

GFCI outlet(s) missing at recommended area(s). You should have GFCI outlets installed to avoid possible injury.

Recommendation

Contact a qualified professional.



#### 7.7.2 GFCI/AFCI

# RECEPTACLES NOT WEATHERPROOF WHEN IN USE



Safety Defects

The exterior covers may not be fully weather proof when in use or missing covers. You should have the covers updated to the current standard.

Recommendation

Contact a qualified professional.



#### 7.8.1 Smoke Detectors

# MISSING SMOKE DETECTORS

**BEDROOMS** 

Some smoke detectors were missing at the time of this inspection. This is a safety concern. Smoke alarms should be installed at all appropriate locations according to current safety standards.

Recommendation

Contact a qualified professional.



#### 7.9.1 Carbon Monoxide Detectors

#### **CARBON MONOXIDE MISSING**



Carbon monoxide detectors were missing at bedroom areas. This is a safety concern. Carbon monoxide dectectors should be installed according to current safety standards.

Recommendation

Contact a qualified professional.

CDA Inspection Services Page 10 of 15



#### 8.5.1 Sinks/Tubs/Showers/Toilets

#### **SLOW DRAIN**



The drain is slow at the sink(s). The drain should be clear to allow for functional flow.

Recommendation

Contact a qualified professional.





### 9.3.1. This has been fixed by an HVAC company on 10-22-24. Receipt to be provided.

9.3.1 Normal Operating Controls

#### **INOPERABLE**



After testing the emergency heat, the thermostat stopped responding. The error code on the unit indicates a low voltage issue. This should be further evaluated and repaired by a qualified HVAC professional.

#### 10.2.1 Heat Pump

#### EXTERIOR UNIT IS AT OR BEYOND NORMAL SERVICE LIFE



The exterior unit is at or beyond the end of its normal service life. We recommend having it serviced prior to settlement. You should budget to replace the system in the future.

Recommendation

Contact a qualified professional.

#### 10.6.1 Air Filter(s)

#### DIFFICULT TO CHANGE FILTER - ATTIC UNIT



The filter in the attic unit difficult to change because of location. Failure to change the filter frequently will result in lower operating efficiency and higher costs. You may wish to modify the doors to improve the serviceability of the filter.

Recommendation

Contact a qualified professional.

CDA Inspection Services Page 11 of 15

# 11.6.1 Laundry MISSING DRIP PAN



There is no drip pan present. When located on or above finished spaces you should have a drip pan installed beneath the washer to prevent possible moisture damage.

Recommendation Contact a qualified professional.



# 12.6.1 Garage Door Opener

# NO AUTO REVERSE WITH A (2X4)



The garage door does not reverse with an obstruction or a (2x4). This is a safety concern. The door should be further evaluated and adjusted for fully functional auto reverse.

Recommendation Contact a qualified professional.



# 12.6.2 Garage Door Opener

### **MISSING SENSORS**



There were no electronic eye sensors present. You should have these installed for external entrapment protection.

Recommendation Contact a qualified professional.





#### 12.6.3 Garage Door Opener

# **OPENER MUST BE HELD DOWN**



The garage door opener must be held down to fully close the door. This is a simple fix.

Recommendation

Contact a qualified professional.

CDA Inspection Services Page 12 of 15





# 13.2.1 Steps, Stairways & Railings **NO RETURNS**



BASEMENT, BACK STAIRS

No returns are present on the handrail(s). Returns are installed so that you do not catch articles of clothing or carried items on the end of the rail. This is a safety concern due to possible injury. You should consider having rail end returns installed.

Recommendation Contact a qualified professional.



# 13.2.2 Steps, Stairways & Railings

# HANDRAIL NOT CONTINUOUS



BASEMENT

The handrail is not continuous. The handrail should be continuous to prevent possible injury.

Recommendation Contact a qualified professional.



#### 13.5.1 Floors

#### **CARPET IN BATHROOM**





Maintenance / Service

Carpeting is present in the bathroom. Carpeting is not waterproof and can lead to moisture retention issues such as mold and bio growth.

Recommendation

Contact a qualified professional.

**CDA Inspection Services** Page 13 of 15





# 13.6.1 Doors **DAMAGED DOOR(S)**

**BACK ADDITION** 

The door(s) is damaged. Recommend repair or replacement.

Recommendation

Contact a qualified professional.





13.6.2 Doors

# **LOOSE HARDWARE**

2ND FLOOR BACK BEDROOM

One or more doors has loose hardware. This could be repaired by a handyman.

Recommendation

Contact a qualified professional.





13.7.1 Windows
SEAL FAILURE
PRIMARY BATHROOM



CDA Inspection Services Page 14 of 15



Maintenance / Service

Observed condensation between the window panes, which indicates a failed seal. Recommend further evaluation by a qualified contractor for repair or replacement.



13.7.2 Windows

# **BROKEN WINDOW PANE**



ATTIC ABOVE GARAGE

There is a broken window pane(s). This is a safety concern. The sash(s) should be replaced.

Recommendation Contact a qualified professional.



CDA Inspection Services Page 15 of 15